

BHCC Route Repair Report-Limestone

Route Name : Buttress
Formation Name : Ice Box
Area Name : Ice Box
Region Name : Spearfish Canyon
Grade : 5.11a
Repair Date :
Rpaired By : Mike Cronin

Route Repair Notes :

Hardware Installed : Anchor

2 Wave Bolt
2 Oval Quick Link
2 Rappel Ring

Route

5 Wave Bolt

Hardware Removed : Anchor

Route

Hardware Notes :